

- Area 2 -- Located at N41° 29.899'/W88° 06.937'. This is an area of rill development prior to the runoff flowing down the channel bank. The rill is approximately 60 feet long, 2 to 3 feet wide and up to 1.5 feet deep. There is a slight forking in the rill toward the south end.

The recommended repair should include fill in the rill with clayey top soil and seed with a mix of all purpose seed and annual rye. This should then be covered with a green wood fiber erosion blanket. A straw log should be placed along the top of the subject area to help reduce sheet runoff erosional effects.

All other areas along the cover that have undergone repair over the last three years appear in good condition with no additional detrimental erosion effects being displayed at this time.

KPRG met with Allied Landscaping at the site to show the areas of required repair to facilitate a contractor cost estimate. Upon receipt of Allied's estimate, KPRG will follow-up with a separate cost estimate for implementation of the recommended repairs.

KPRG appreciates the continued opportunity for providing our technical services to Midwest Generation. If there are any questions, please contact me at 262-781-0475.

Sincerely,
KPRG and Associates, Inc.



Richard R. Gnat, P.G.
Principal

Photo documentation - Joliet #29 Ash Burial Area Inspection 8/11



1. Area 1 rill incised down side bank.



2. Area 1 top of bank exposed surface.



3. Area 2 rill marked with lathe.

4.

